

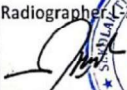


LAMPIRAN

 batan	BADAN TENAGA NUKLIR NASIONAL SEKOLAH TINGGI TEKNOLOGI NUKLIR JL. BABARSARI KOTAK POS 6101 YKBB YOGYAKARTA 55281 Phone. 0274-484085; Fax: 0274-489715 www.sttn-batan.ac.id	 YOGYAKARTA																																												
RADIOGRAPHY TEST REPORT																																														
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td>Date</td><td>07/03/2019</td></tr> <tr><td>Welder</td><td>-</td></tr> <tr><td>Company</td><td>UGM</td></tr> <tr><td>Address</td><td>YOGYAKARTA</td></tr> <tr><td>Welding Type</td><td>MIG</td></tr> </table>	Date	07/03/2019	Welder	-	Company	UGM	Address	YOGYAKARTA	Welding Type	MIG	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td>Report No</td><td>010/RT/03/2019</td></tr> <tr><td>Drawing No</td><td>11 - 18</td></tr> <tr><td>IPC</td><td></td></tr> <tr><td>Standart</td><td>ASME VIII</td></tr> </table>	Report No	010/RT/03/2019	Drawing No	11 - 18	IPC		Standart	ASME VIII	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td colspan="2">Technical Data :</td></tr> <tr><td>Radiation Source</td><td>X-RAY</td></tr> <tr><td>Material Thick</td><td>5 mm</td></tr> <tr><td>Source Size</td><td>2 mm</td></tr> <tr><td>Film to Source</td><td>600 mm</td></tr> <tr><td>Expose Time</td><td>(50)s</td></tr> <tr><td>Kvp/Curie</td><td>75</td></tr> <tr><td>Screen</td><td>Pb</td></tr> <tr><td>Density</td><td>2.5-2.8</td></tr> <tr><td>IQI</td><td>1A ASTM Kawat No.5</td></tr> <tr><td>Sensitivity</td><td>0.02</td></tr> <tr><td>Film Type</td><td>Agfa-D7</td></tr> <tr><td>Material Type</td><td>Al</td></tr> </table>	Technical Data :		Radiation Source	X-RAY	Material Thick	5 mm	Source Size	2 mm	Film to Source	600 mm	Expose Time	(50)s	Kvp/Curie	75	Screen	Pb	Density	2.5-2.8	IQI	1A ASTM Kawat No.5	Sensitivity	0.02	Film Type	Agfa-D7	Material Type	Al
Date	07/03/2019																																													
Welder	-																																													
Company	UGM																																													
Address	YOGYAKARTA																																													
Welding Type	MIG																																													
Report No	010/RT/03/2019																																													
Drawing No	11 - 18																																													
IPC																																														
Standart	ASME VIII																																													
Technical Data :																																														
Radiation Source	X-RAY																																													
Material Thick	5 mm																																													
Source Size	2 mm																																													
Film to Source	600 mm																																													
Expose Time	(50)s																																													
Kvp/Curie	75																																													
Screen	Pb																																													
Density	2.5-2.8																																													
IQI	1A ASTM Kawat No.5																																													
Sensitivity	0.02																																													
Film Type	Agfa-D7																																													
Material Type	Al																																													
	Identifications	Defect Type	Result																																											
PLAT	MIG 11	Incomplete Penetration (IP: 0.8 mm) Dan Distributed Porosity (Diameter 1-2 mm)																																												
	MIG 12	Clustered Porosity Φ 5mm dan Mismatch	CP-kecil 2 tempat (las cukup bagus)																																											
	MIG 13	Incomplete Penetration (IP: 40 mm) Dan Distributed Porosity (Diameter 1-2 mm)	Porosity terlalu banyak (ukuran 1-2 mm cukup banyak)																																											
	MIG 14	Incomplete Penetration (IP: 20 mm) Dan Distributed Porosity (Diameter 1-3 mm)	Porosity terlalu banyak dan ada ukuran yg besar																																											
	MIG 16	Elongated cavity 30 mm Dan Porosity (Diameter 1 mm)	EC-kecil ; Porosity hanya 3 buah (Las cukup Bagus)																																											
	MIG 17	Distributed Porosity dibawah 1 mm; Linier Porosity dan Mismatch	Porosity kecil; Mismatch (Las cukup Bagus)																																											
	MIG 18	Clustered Porosity sepanjang 20 mm dan External Undercut	CP-cukup panjang; EU-60 mm																																											
	Note :																																													
YOGYAKARTA, 07 Maret 2019 Radiographer L-2  TASIH MULYONO																																														
